


Nuts

Cap (Acorn) Nuts

Low Crown—Steel
& Stainless

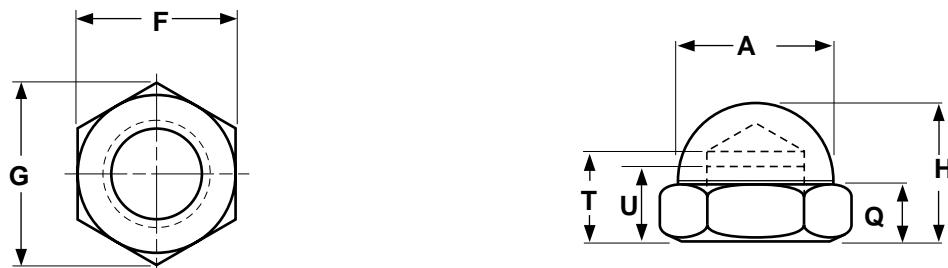

ONE PIECE HEX CAP NUTS, LOW CROWN

SAE J483

Nominal Size or Basic Major Diameter of Thread		F		G		A	H	Q	T	U
		Width Across Flats		Width Across Corners		Body Diameter	Overall Height	Hexagon Height	Drill Depth	Full Thread
		Max	Min	Max	Min				Max	Min
6	0.1380	0.3125	0.302	0.361	0.344	0.30	0.34	0.16	0.25	0.16
8	0.1640	0.3125	0.302	0.361	0.344	0.30	0.34	0.16	0.25	0.16
10	0.1900	0.3750	0.362	0.433	0.413	0.36	0.41	0.19	0.28	0.19
1/4	0.2500	0.4375	0.428	0.505	0.488	0.41	0.47	0.22	0.34	0.25
5/16	0.3125	0.5000	0.489	0.577	0.557	0.47	0.53	0.25	0.41	0.31
3/8	0.3750	0.5625	0.551	0.650	0.628	0.53	0.62	0.28	0.45	0.38
1/2	0.5000	0.7500	0.736	0.866	0.840	0.72	0.81	0.38	0.59	0.50
5/8	0.6250	0.9375	0.922	1.083	1.051	0.91	1.00	0.47	0.75	0.62
3/4	0.7500	1.0625	1.045	1.227	1.191	1.03	1.16	0.53	0.88	0.75

TWO PIECE HEX CAP NUTS

Nominal Size or Basic Major Diameter of Thread		F		G		H	
		Width Across Flats		Width Across Corners		Overall Height	
		Max	Min	Max	Min	Max	Min
4	0.1120	0.248	0.225	-	-	0.200	0.177
5	0.1250	0.3125	0.302	0.361	0.344	0.260	0.240
6	0.1380	0.3125	0.302	0.361	0.344	0.260	0.240
8	0.1640	0.3125	0.302	0.361	0.344	0.260	0.240
10	0.1900	0.3750	0.362	0.433	0.413	0.291	0.271
1/4	0.2500	0.4375	0.423	0.505	0.482	0.338	0.318
5/16	0.3125	0.562	0.545	0.650	0.621	0.385	0.365
3/8	0.3750	0.625	0.607	0.722	0.692	0.432	0.412
1/2	0.5000	0.750	0.736	0.866	0.840	0.572	0.552
5/8	0.6250	0.938	0.909	1.083	1.037	0.807	0.787
3/4	0.7500	1.12	1.08	-	-	1.12	1.08

Description	Steel: The low-crown cap nut is usually manufactured in two pieces, a hex nut and an acorn-shaped top, zinc die cast to form the finished part. Stainless: Similar in design to the steel nut but made from an austenitic stainless alloy. Nuts may be one or two-piece style.
Applications/ Advantages	Cap nuts serve two main purposes: (1) as decorative pieces, and (2) as covers for projecting threads.
Material	Steel: Nuts shall be made from a low-carbon steel which conforms to the following chemical composition requirements-- <i>Carbon: 0.47% max.; Phosphorus: 0.12% max.; Sulfur: 0.23% max..</i> Stainless: 304L or equivalent stainless.
Plating	See Appendix-A for information about the plating of steel cap nuts.